

MARYSVILLE, CALIFORNIA

HI-TACAN Z RWY 33

TACAN BAB Chan 23	APCH CRS 317°	Rwy ldg TDZE Arpt Elev	12,001 105 113
----------------------	------------------	------------------------------	----------------------

- (USAF)


BEALE AFB (KBAB)

⚠ *When ALS inop, increase CAT CDE vis to 1 1/4 miles.
**Circling not authorized NE of Rwy 1-5-33.

ALSIF-1
A1

MISSED APPROACH: Climb to 3600, intercept BAB TACAN R-326 to HAPAK and hold.

ATIS★ 124.55 273.5	NORCAL APP CON 125.4 259.1	TOWER★ 119.4 284.75	GND CON 121.6 257.75
-----------------------	-------------------------------	------------------------	-------------------------

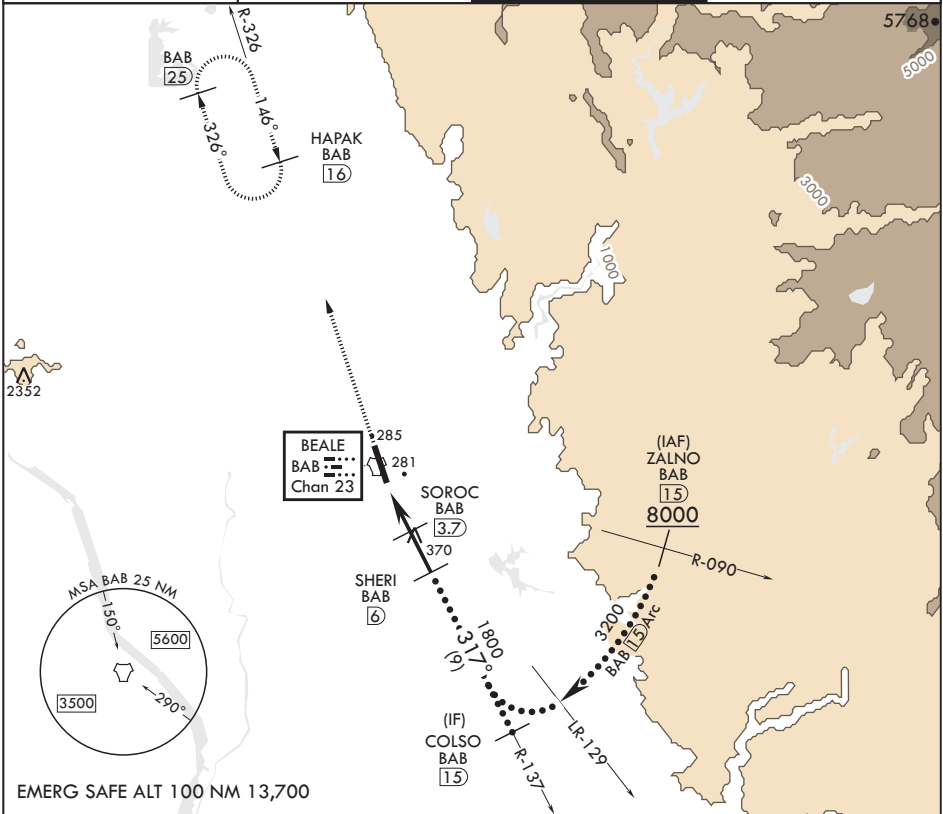

3600
↑
BAB
R-326

HAPAK
BAB
16

TACAN

EGUYO
1.5

2.2

1000

≤ 3.09°
TCH 51

2.3 NM

SHERI
6
1800

COLSO
15
3200

317°

3200

ELEV 113

TDZE 105

A1

51

BCN
240

TWR
274

13,001 x 300

33

317°

CATEGORY	C	D	E
S-33*	540/40	435	(500-¾)
CIRCLING**	600-1½ 487 (500-1½)	800-2¼ 687 (700-2¼)	800-2½ 687 (700-2½)

HIRL all Rwy's

MARYSVILLE, CALIFORNIA

39°08'N - 121°26'W

BEALE AFB (KBAB)

Amtdt 6 25JAN24

HI-TACAN Z RWY 33