


KING SALMON, ALASKA

22307


HI-VOR Z or TACAN Z RWY 30

VORTAC AKN 112.8 Chan 75	APCH CRS 296°	Rwy Idg 8501 TDZE 73 Arpt Elev 73	AL-1237 [USAF]		KING SALMON (PAKN)	
DME required.			MISSED APPROACH: Climbing left turn to 3000 on heading 240° and on AKN VORTAC R-210 to OLLER/ 15 DME and hold.			
▼ 33 -31° C						
ATIS 128.8	ANCHORAGE CENTER 124.8 354.0		TOWER ★ 118.3 279.5	GND CON 121.9	CTAF 121.90 352.05	UNICOM 122.95

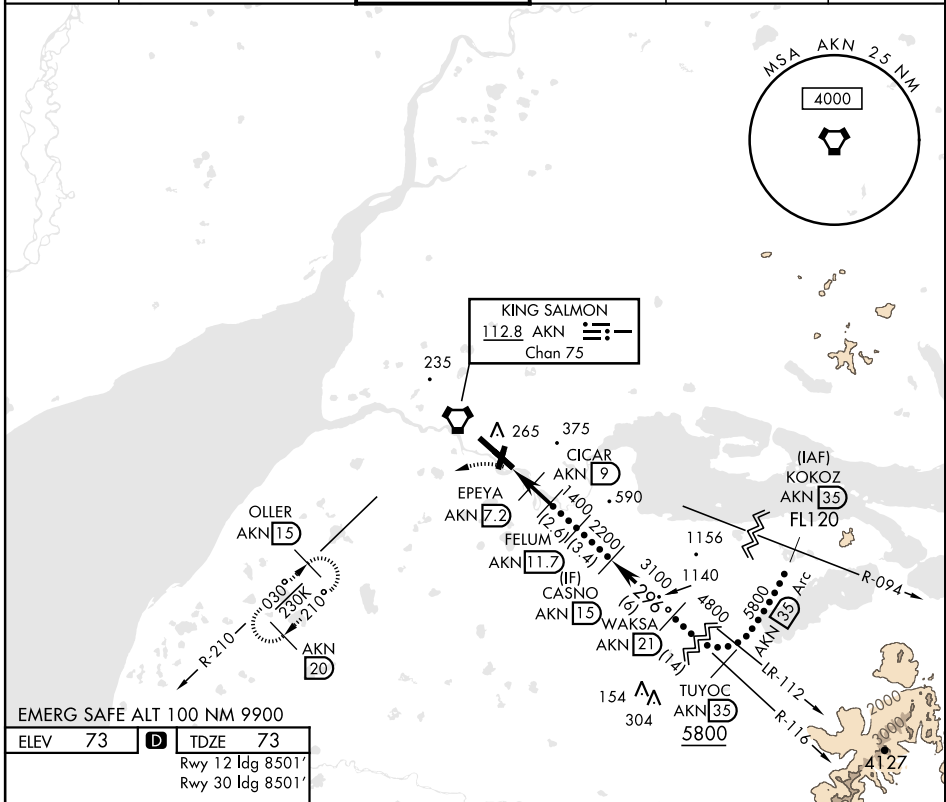

EMERG SAFE ALT 100 NM 9900

ELEV 73	D	TDZE 73
Rwy 12 Idg 8501'		
Rwy 30 Idg 8501'		

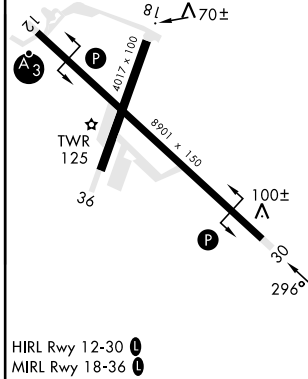

3000		AKN R-210	OLLER AKN 15
hdg 240°			
VORTAC		EPEYA AKN 7.2	CASNO 15
5.1 6.3		FELUM 11.7	CICAR 9
800		1400	3100
2.1 NM		1.8 NM	
CATEGORY	C	D	E
S-30	480-1½	407	(500-1½)
CIRCLING	580-1½ 507 (600-1½)	900-2¾ 827 (900-2¾)	960-3 887 (900-3)

KING SALMON, ALASKA

58°41'N-156°39'W

KING SALMON (PAKN)

Amtd 6 03NOV22

HI-VOR Z or TACAN Z RWY 30

AK, 25 JAN 2024 to 21 MAR 2024

AK, 25 JAN 2024 to 21 MAR 2024