

LOM AK	APP CRS	Rwy Idg	3947
362	351°	TDZE	1129
		Apt Elev	1134

NDB RWY 1

KENT STATE UNIVERSITY (1G3)


▼

NA

When local altimeter setting not received, use Akron Fulton Intl altimeter setting.
Rwy 1 helicopter visibility reduction below ¾ SM NA.

MISSED APPROACH: Climbing left turn to 3100 direct AKRON LOM and hold.

AWOS-2 119.15	AKR ASOS 126.825	CLEVELAND APP CON★ 125.5 371.875	CLNC DEL 125.65	UNICOM 122.725 (CTAF)	122.9 0
------------------	---------------------	-------------------------------------	--------------------	--------------------------	---------

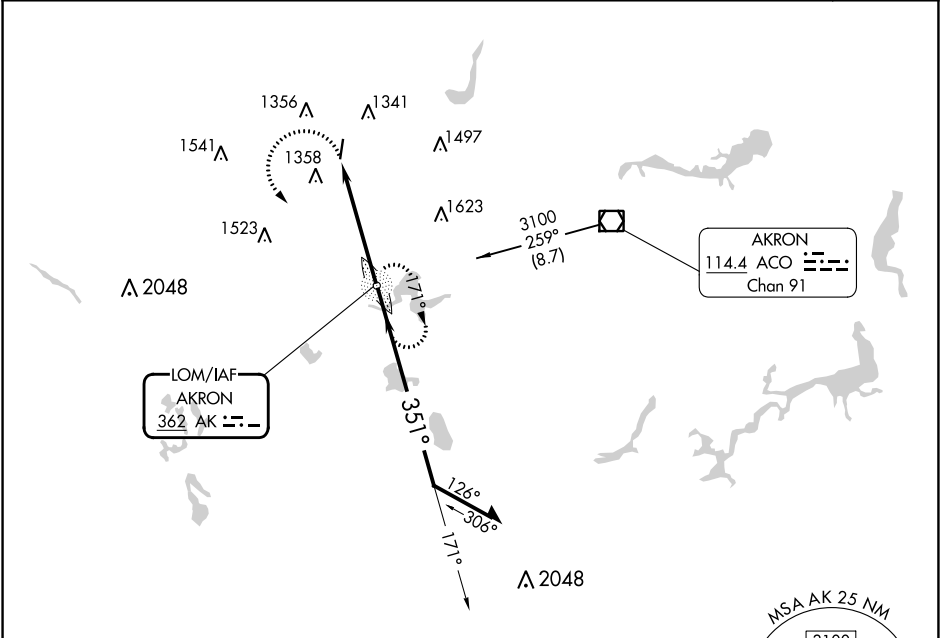

ELEV 1134

TDZE 1129

FAF to MAP 4.8 NM

Knots	60	90	120	150	180
Min:Sec	4:48	3:12	2:24	1:55	1:36

3100 AK

AK LOM

Remain within 10 NM

171°

3100

351°

2800

4.8 NM

VGSI and descent angles not coincident (VGSI Angle 3.50/TCH 42).

≤3.25° TCH 42

CATEGORY	A	B	C	D
S-1	1760-1 631 (700-1)	1760-1 631 (700-1)	1760-1 631 (700-1)	NA
CIRCLING	1760-1 626 (700-1)	1760-1 626 (700-1)	1760-1 626 (700-1)	NA